

AC-224AP & AC-7072 Wireless LAN Controller FSOS 11.9(6)W3S6 Software Release Notes

Models: AC-224AP, AC-7072

Content

1 Version Information	1
1.1 Historical Version Release Record	1
2 Function Description	1
2.1 Added Features	1
2.2 Changed Features	1
3 Fixed Problems	1
4 Known Issues	2
5 Compatibility Notes	2
5.1 Hardware Instructions	2
6 Upgrade Instructions	3
6.1 Upgrade File	3
6.2 Upgrade requirements	3
6.3 Precautions	4

1 Version Information

Version Number	AC_FSOS 11.9(6)W3S6
Version Type	Customized Version
Applicable Products	AC-224AP V1.xx AC-7072 V1.xx AP Products: AP-N635, AP-N505, AP-W6Q4134C, AP-T567, AP-T565, AP-N515H, AP-W6T3267C, AP-W6T10000C, AP-W6D1775C
Release Type	Officially Release
Release Date	2024-09-27
Baseline versions	AC_FSOS 11.9(6)W3B4 (10172203)
Reason for release	Bug Revisions

1.1 Historical Version Release Record

Release Date	Version Number	Status
2023-12-15	AC_FSOS 11.9(6)W3S6	invalidate
2024-05-31	AC_FSOS 11.9(6)W3S6	invalidate

2 Function Description

2.1 Added Features

None

2.2 Changed Features

None

3 Fixed Problems

Question Number	Problem Description	First Found Version
BUG-1234385	Due to WPA3 encryption issues, the terminal fails to roam between different APs	AC_FSOS 11.9(6)W3B4, (10172203)

4 Known Issues

None

5 Compatibility Notes

5.1 Hardware Instructions

Hardware Model	Hardware Version Number	Description
AC-224AP	V1.xx	Wireless controller with 8 Gigabit Ethernet ports and 2 shared SFP ports.
AC-7072	V1.xx	Wireless controller with 8 combo ports and 4 SFP+ 10-Gigabit ports.

6 Upgrade Instructions

6.1 Upgrade File

6.1.1 AC-224AP

File Name	AC_FSOS11.9(6)W3S6_G2C6-01_11212320_install.bin
File Description	System upgrade installers, customized versions
File Size	68527622 Bytes
Applicable Products	AC-224AP V1.xx
MD5	854151c8c1916c8efc30faf0a7a1d195
Software Version	AC_FSOS 11.9(6)W3S6, Release(11212320)

6.1.2 AC-7072 V1.xx


File Name	AC_FSOS11.9(6)W3S6_G3C8-01_11212318_install.bin
File Description	System upgrade installers, customized versions
File Size	137491812 byte
Applicable Products	AC-7072 V1.xx
MD5	e9aebc8387d048c61cc49a6f720d422f
Software Version	AC_FSOS 11.9(6)W3S6, Release(11212318)

6.2 Upgrade requirements

None

6.3 Precautions

- The upgrade must undergo successful verification in a controlled environment prior to its deployment in the actual field.
- The customer's database should be backed up before conducting an on-site upgrade.
- During the upgrade, refrain from turning off or resetting the system, or plugging or unplugging modules once the message prohibiting rebooting appears.
- During the upgrade/downgrade process, carefully monitor the prompt messages displayed. If a failure occurs, save the log message and contact FS Network technical support.
- After completing the upgrade/downgrade, use the "show version detail" command to confirm the current device version. If the current version matches the target version, the upgrade was successful.

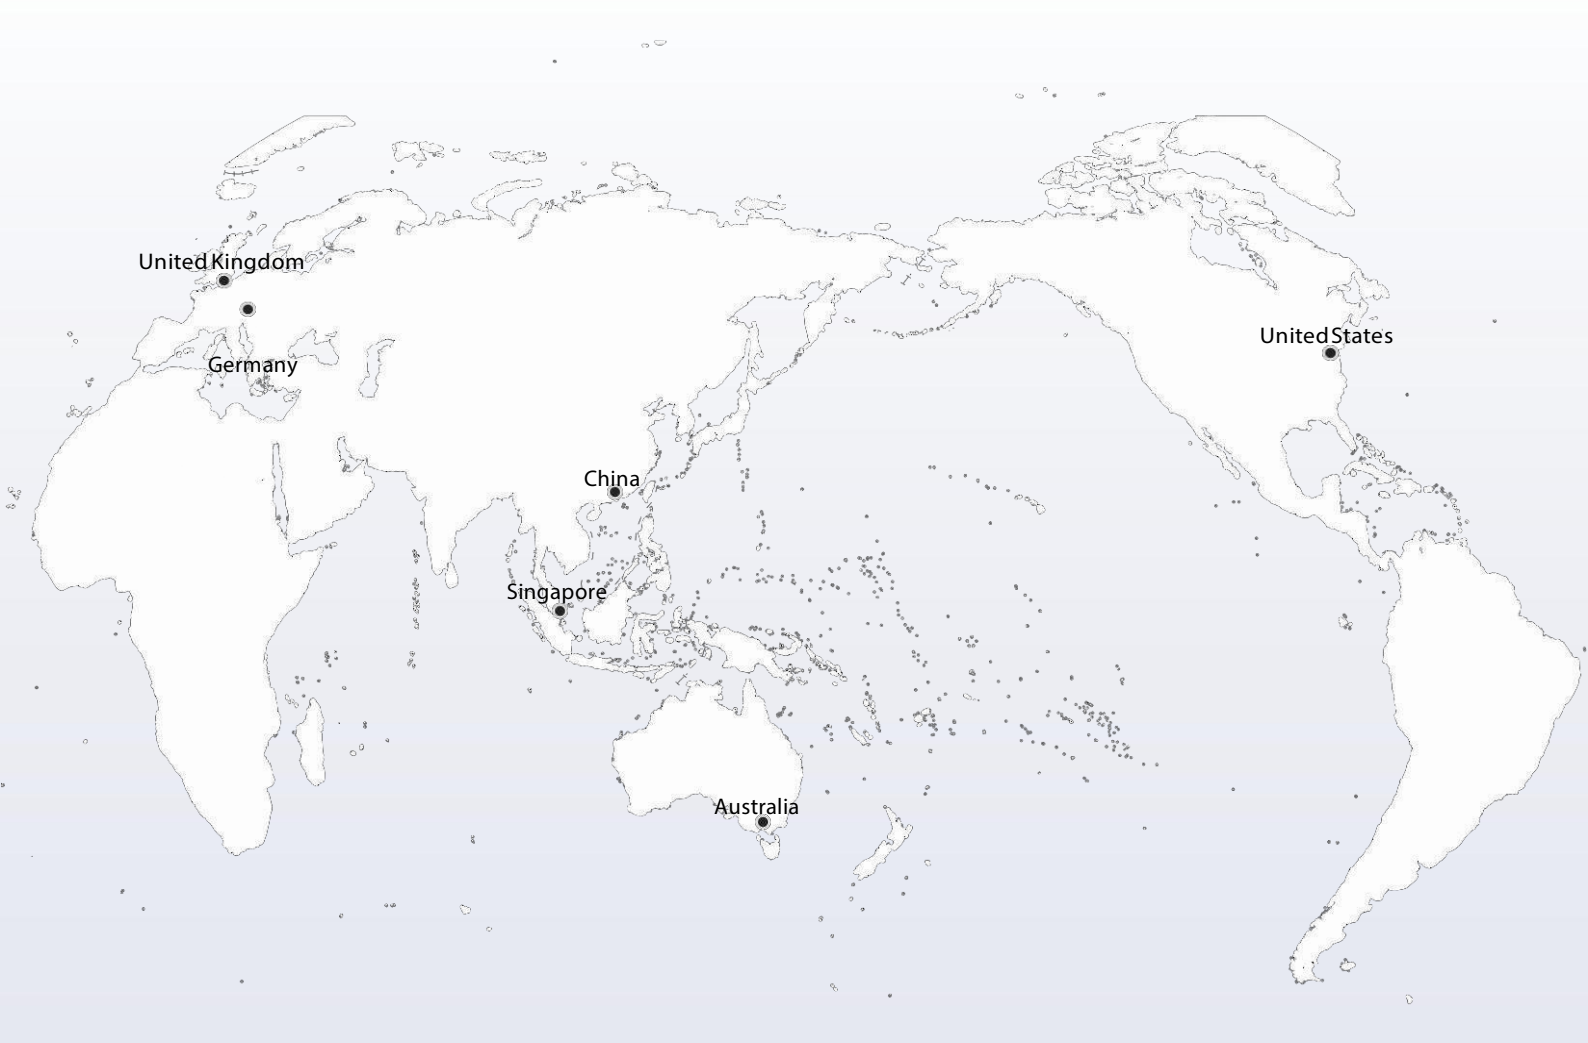

<https://www.fs.com>



The information in this document is subject to change without notice. FS has made all efforts to ensure the accuracy of the information, but all information in this document does not constitute any kind of warranty.